	DCC Number: E070295-00-D
advancedligo	Date Prepared: 11/16/07

Originator		Cognizant Engineer	Ext./Phone#	Project	Account N	Number
Brian O'Reilly	Ken Ma	son	617-324-5250	ELIGO HAM SEI		
Dwg/Part Number	Rev	Part Description	Material	Serial N	Number	Qty
D071120-D		actuator mount / AL 6061			6	

Used In (next higher assembly):

	Vendor Name	PO/Contract Number
HPD		

Data Package, Receiving/Inspection Remarks:

Inspection Required Y/N	Visual Damage Y/N	Comments	Name/ Initials	Date Comp.
YES	NONE			

Process Flow:

1 *

#		Operation	5 a bi	Start Date	Work Area		Instructions	Name/ Initials	Date Comp.
1	Clean				Caltech	0	clean per E960022: Ultrasonic clean in		
			-		-		Liquinox ¹ for 10 minutes.	-	
						0	Rinse in distilled water at least 3 times,	×	~

Standard Liquinox solution is 1 tablespoon in 1 gallon of water.

N.B.: A copy of this traveller must be submitted to the DCC each time the original is shipped with the associated part(s) and when the traveller has been completed.

	DCC Number: E070295-00-D
advancedligo	Date Prepared: 11/16/07

#	Operation	Start Date	Work Area	Instructions	Name/ Initials	Date Comp.	
				changing the rinse water every time.			
				• Ultrasonic clean in methanol for 10 minutes.			
_	U DI			F0(0000 10000 401			
2	Vacuum Bake			per E960022: 120°C, 48 hrs			
3	Control Point			Review/Approve RGA scan			
4	Wrap & Tag vacuum clean						
	parts						
5	Ship and Deliver/File			Please send to:			
	paperwork			LLO			
				c/o Ken Mason			
				File one copy of traveler with the DCC.			
				Note: Ship original traveler with these parts.			
EN	END: Go to Traveler or procedure associated with next higher assembly processing						

Special Instructions (Handling/Packaging Constraints, Remarks, etc.) or Notes:

Note that these items were also listed on traveler #E070236 but were left out of the shipping crate with the other parts listed on that traveler.


.


N.B.: A copy of this traveller must be submitted to the DCC each time the original is shipped with the associated part(s) and when the traveller has been completed.

~

.

Dycor System 200

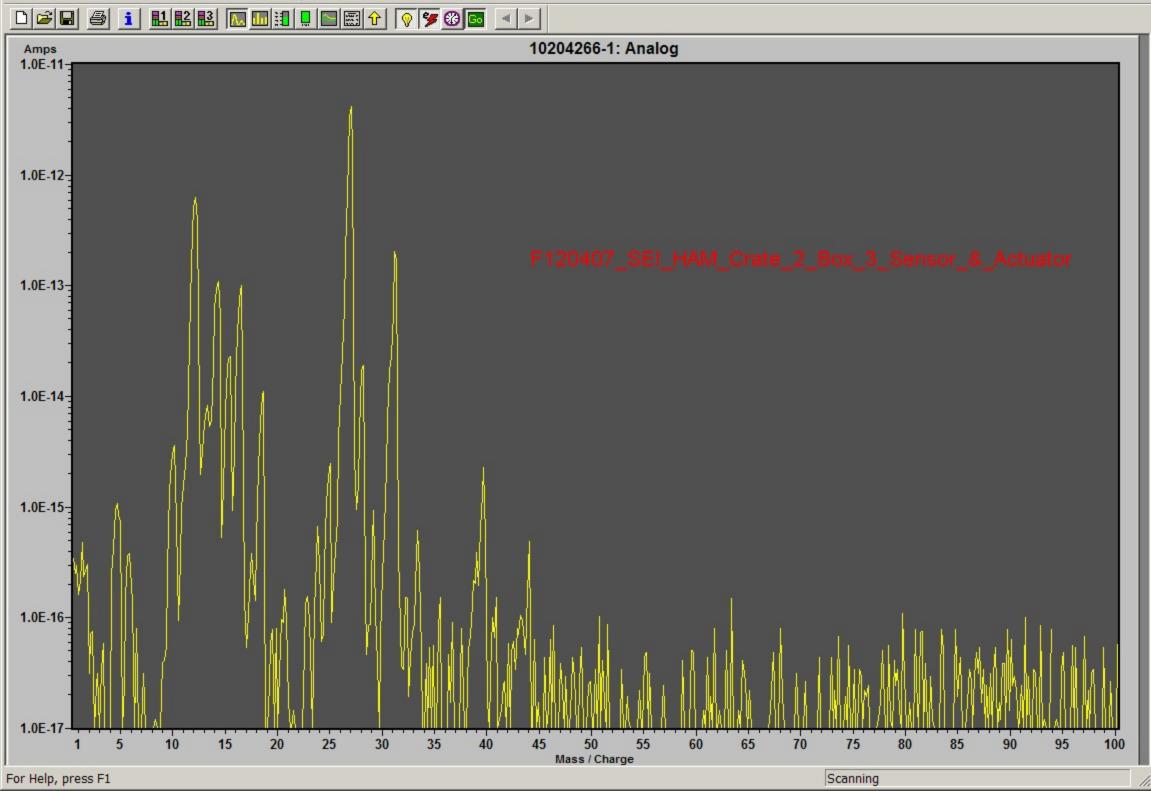

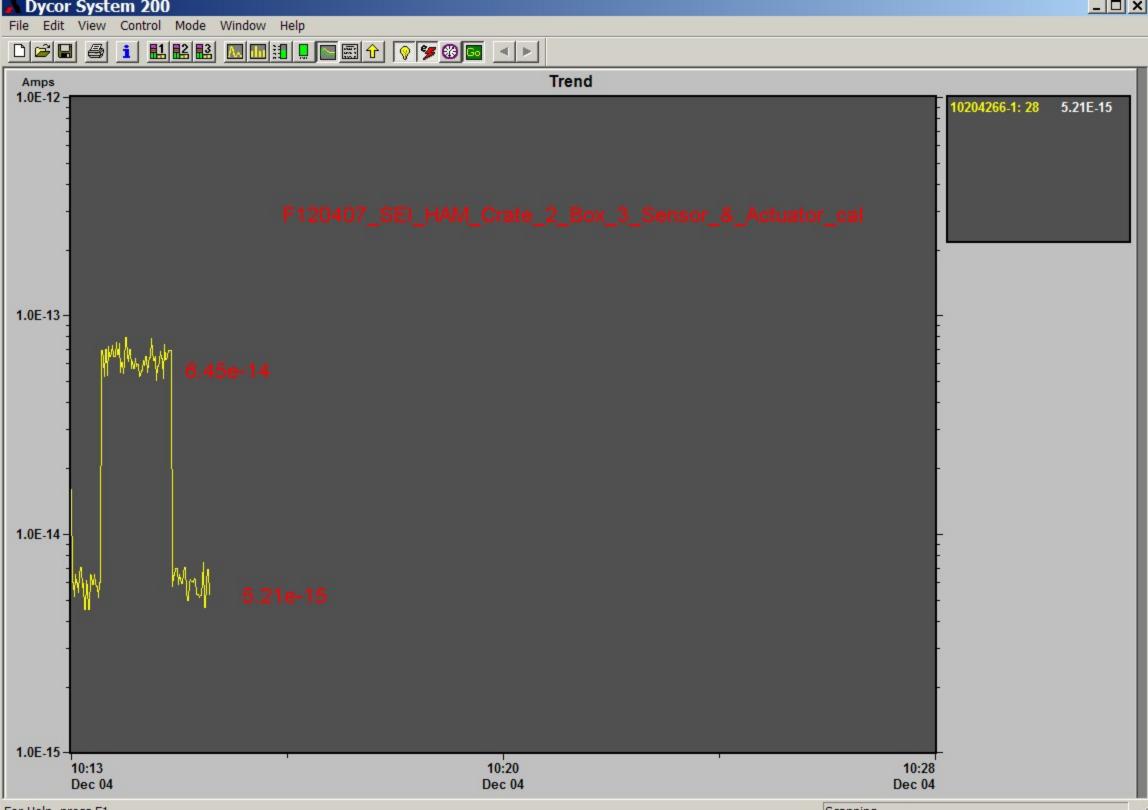

For Help, press F1

Scanning

1

Pressure Contribution from Flag Hydrocarbons

40M Lab RGA Scan Results

Job# F120407		iption: SEI Ham Crate 1,Box2, Sensor,& Act	Date: 12/4/2007
	Oven	Used: C	
AMU 41	1.50E-16 amps	from RGA scan listing	
AMU 43	1.00E-16 amps	from RGA scan listing	
	-	6	
AMU 53	3.50E-17 amps	from RGA scan listing	
AMU 55	2.00E-17 amps	from RGA scan listing	
AMU 57	2.00E-17 amps	from RGA scan listing	
Sum Flag H/C AMUs	3.25E-16 amps		
Calib leak rate	2.36E-10 torr l/s	(Argon)	
AMU 40 (w/leak open)	6.45E-14 amps		
AMU 40 (background)	5.21E-15 amps		
Calib leak contributes	-	= (w/leak open) - (background)	
	coch i mps	(, ioun open) (cueriground)	
Flag H/C Outgassing	1 294E-12 torr 1/s	= (Sum Flag H/C AMUs) x (Calib leak rate)/(0	alib leak contrib)
	1.2712 12 1011 13		curro reak contrio.)
Test item surf area	1.00E+04 cm2		
Test item suit area	1.00L+04 CIII2		
NT	1.004E 16 (a) 1/2		
Normalized outgassing	1.294E-16 torr l/s	-cm2 = Flag H/C Outgassing/Test item surf ar	ea
		205 00 F070205 00 A 1	1 070226 00
		295-00, E070285-00, And some parts ar on Tr	aveler E0/0236-00
Full description	marked with * (al	l aluminum narts)	

Full description: marked with *. (all aluminum parts)

Pre-scan bake:

120C for 48Hrs