


8 7 6 5 4 3 2 1



NOTES: (UNLESS OTHERWISE SPECIFIED)

1. REMOVE ALL BURRS AND BREAK SHARP EDGES TO A MAXIMUM OF .015
2. PART NUMBER (DRAWING NO., DASH NO., REVISION NO., SERIAL NO.) TO BE CLEARLY MARKED ON THE PART ITSELF

REV.	DATE	DCN #	DRAWING TREE #

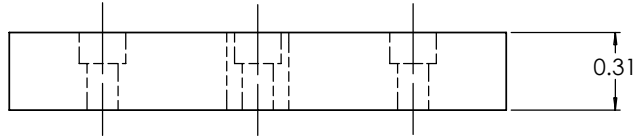


4X $\varnothing 0.125$ THRU
 $\varnothing 0.19 \nabla 0.13$

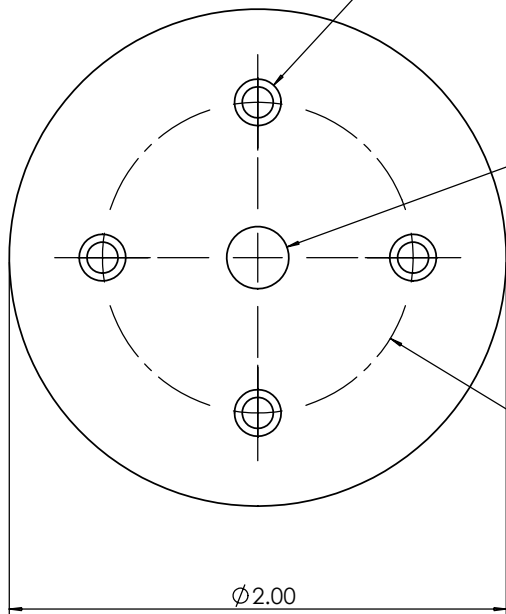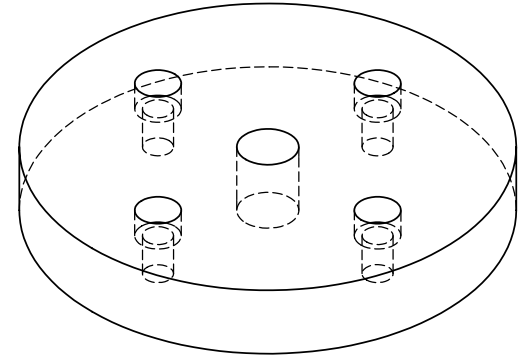

1/4-20 UNC-2B THRU

$\varnothing 1.25$ BC

ITEM NO.	REQ. QUANTITY	SPARE	TOT.	PART NUMBER	DESCRIPTION	SUPPLIER	
PARTS LIST							
UNLESS OTHERWISE SPECIFIED:				DATE	NAME	 CALIFORNIA INSTITUTE OF TECHNOLOGY MASSACHUSETTS INSTITUTE OF TECHNOLOGY	
DIMENSIONS ARE IN INCHES				DRAWN	7/8/03		D MASON
TOLERANCES:				CHECKED			
.XX ± .01							
.XXX ± .005							
ANGULAR: ±1							
MATERIAL				COMMENTS:		NEXT ASSY	
6061-T6 AL						PART NAME	
FINISH						SIZE	
NONE						B	
						DWG. NO.	
						D030315-00-D	
						REV	
				SCALE: 2:1		D030315-00.SLDDRW	
						SHEET 1 OF 1	